

Inspection/Final Report

| | | | |
|--------------------|-----------------------------|-------------------------------|-------------------|
| Client | : Total Military Management | Adjuster | : TMM Inspections |
| Adjuster Ph | : | Date | : Feb 20, 2023 |
| GBL# | : HAFC0647578 | Received | |
| Valuations | : FVP | Estatus Ref # | : 667189 |
| Shipper | : Laurence Peterson | Admin | : Jeff Schatzman |
| Home Ph | : | Additional Information | : |
| Work Ph | : | Cell Ph | : |
| Address | : Colorado Springs CO | E-Mail | : |

Items List










| # | Photos | Item Description | Condition/ Recommendations/ Repairs | Costs |
|---|---|------------------|--|--|
| SI No: 1 Inv#: 414671 7-085 Wt: 0 Ctn Avail: No |  Image1  Image2  Image3  Image4  Image5 | TV Stand | The TV stand has both back legs broken off with the rsf leg completely missing. New transit damage, not repairable. Similar: \$235.99/Claimed: \$353.59 https://www.amazon.com/Crosley-Furniture-Alexandria-42-inch-Stand/dp/B00495KM2S/ref=asc_df_B00495KM2S/ | Est: 0.00 C/S: 235.99 Fee: 0.00 |
| SI No: 2 Inv#: 414671 7-078 Wt: 0 Ctn Avail: No |  Image1  Image2  Image3  Image4 | 3 Shelf Cubicle | The 3-shelf cube bottom shelf is ripped out near the dowels. New transit damage, not repairable MDF. Similar: \$23.99/Claimed: \$35.00 https://www.target.com/p/iris-usa-3-cube-modular-storage-box-shelf-brown-oak/-/A-88504978 | Est: 0.00 C/S: 23.99 Fee: 0.00 |



Image5

SI No: 3

Inv#:
414671
7-047

Wt: 0

Ctn Avail:
No



Image1



Image2



Image3



Image4



Image5

Standing Jewelry
Box

Both of the rsf legs as well as the rsf side bottom trim broke off in transit. Repairable, but cost will exceed settlement amount requested.

Similar: \$119.99/Claimed: \$99.99/Repair estimate: \$125.00

<https://www.target.com/p/maev-e-jewelry-armoire-espresso-linon/-/A-86041880>

Est: 0.00

C/S: 99.99

Fee: 0.00

SI No: 4

Inv#:
414671
7-091

Wt: 0

Ctn Avail:
No

PC Gaming Desk

Moving company took the desk away. No photos

Est: 0.00

C/S: 0.00

Fee: 0.00

SI No: 5

Inv#:
414671
7-005

Wt: 0

Ctn Avail:
No

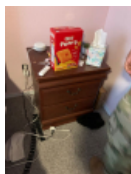


Image1

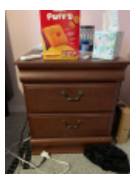


Image2

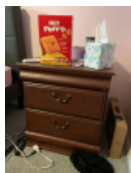


Image3

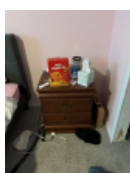


Image4

2 Drawer
Nightstand

Shipper claimed the nightstand was wobbly but technician found it to be stable, no issues. Retail: \$179.99/Claimed: \$169.99

<https://www.cymax.com/Glory-Furniture-Louis-Phillipe-2-Drawer-Nightstand-in-Cappuccino-G3125-N.htm>

Est: 0.00

C/S: 0.00

Fee: 0.00

SI No: 6

Inv#:
414671
7-095

Wt: 0

Ctn Avail:
No

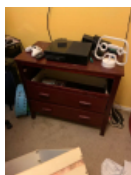


Image1



Image2



Image3

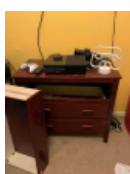


Image4

3 Drawer Dresser

The 3-drawer dresser is missing the top rsf wooden drawer glide that attaches to case. This was noted PED at origin, broken drawer.









Similar: \$199.00 /Claimed: \$121.47



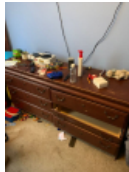

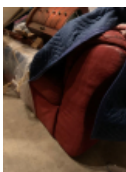



<https://davincibaby.com/products/kalani-3-drawer-dresser>

Est: 0.00

C/S: 0.00

Fee: 0.00

| | | | | | |
|---|---|---|-------------------------|---|--|
| | Image3 | Image4 | | | |
| SI No: 7 Inv#: 414671 7-096 Wt: 0 Ctn Avail: No |  Image1 |  Image2 | 6 Drawer Dresser | The 6-drawer dresser rsf side is separating from the case. Additionally it is missing toe kick. New transit damage, not repairable. Similar: \$499.95/Claimed: \$239.98 https://www.shopbedmart.com/product/furniture/bedroom/mayville-dresser/ | Est: 0.00 C/S: 239.98 Fee: 0.00 |
| SI No: 8 Inv#: 414671 7-115 Wt: 0 Ctn Avail: No |  Image1 |  Image2 | Pink Vanity | The pink vanity is missing hardware to assemble, lost in transit. Not repairable for less than value of the item. Similar: \$129.00/Claimed: \$207.00/Repair estimate: \$225.00 https://www.walmart.com/ip/Roundhill-Furniture-Moniya-Wood-Vanity-Table-and-Stool-Set-Pink/56204365 | Est: 0.00 C/S: 129.00 Fee: 0.00 |
| SI No: 9 Inv#: 414671 7-084 Wt: 0 Ctn Avail: No | | | Black Book Shelf | Shipper discarded. | Est: 0.00 C/S: 0.00 Fee: 0.00 |
| SI No: 10 Inv#: Unknown Wt: 0 Ctn Avail: No |  Image1 |  Image2 | Red 3 Seat Couch | The red sofa is missing 2 feet and has 1 foot broken. This is new transit damage, we can order replacement feet and install. Similar: \$769.99/Claimed: \$399.99/Repair estimate: parts and labor: \$300.00 https://www.wayfair.com/furniture/pdp/wade-logan-bayswater-845-rolled-arm-sofa-w004180318.html?piid=328817544 | Est: 300.00 C/S: 0.00 Fee: 0.00 |
| SI No: 11 Inv#: 414671 7-054 Wt: 0 Ctn Avail: |  Image1 |  Image2 | King Bed Footboard Rail | The wooden footboard rail is split all the way through. Repairable, new transit damage. Similar: \$239.00/Claimed: \$271.15/Repair estimate: | Est: 250.00 C/S: 0.00 Fee: 0.00 |
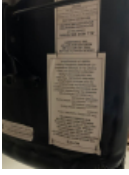
| | | | |
|--|--|--|---|
| No |  Image3 |  Image4 | \$250.00 https://www.amazon.com/Zinus-Deluxe-Platform-Boxspring-Support/dp/B01MRH37QD |
| SI No: 12 Inv#: 414671 7-060 Wt: 0 Ctn Avail: No | Bathroom 3 Shelf Towel Rack | Missing. | Est: 0.00 C/S: 0.00 Fee: 0.00 |
| SI No: 13 Inv#: 414671 7-080 Wt: 0 Ctn Avail: No |  Image1  Image2  Image3  Image4  Image5  Image6 | Computer Chair | The rolling office chair is missing a wheel, lost in transit. Not repairable. Similar: \$91.29/Claimed \$68.99 https://www.amazon.com/AmazonBasics-Puresoft-PU-Padded-Mid-Back-Computer/dp/B081H3Y5NW/ref=sr_1_4 Est: 0.00 C/S: 68.99 Fee: 0.00 |

Inspection/Final Report

| | | | |
|-------------------------------|-------------------------|-----------------------|-----------|
| Date of Report | : | Date Completed | : |
| Type of Report | : | Expenses | : |
| | Inspection/Final Report | | \$ 0.00 |
| Inspection Fee | : | Tax | : |
| | \$ 250.00 | | \$ 0.00 |
| Total C/S | : | Total Est | : |
| | \$ 797.94 | | \$ 550.00 |
| Fees | : | Total | : |
| | \$ 0.00 | | \$ 250.00 |
| Additional information | : | | |